

USER'S GUIDE



COM-100L EC / TDS / TEMPERATURE METER



CONTENTS

Overview	1
Contact Information	1
Specifications	1
Housing and Screen Description	2
Taking Measurements	3
Switching Modes	4
EC / TDS Calibration	5
Care, Maintenance & Techniques	6
Warranty	7

OVERVIEW

Thank you for purchasing HM Digital's COM-100L. The COM-100L is a highly advanced handheld meter that is completely waterproof. The meter measures three parameters: Electrical Conductivity (EC), Total Dissolved Solids (TDS) and temperature. The COM-100L features 2 different conversion factors to convert from EC to TDS, using the 0.7 (442™) or 0.5 (NaCl) factors, as well as selectable modes for measurements in the μS , mS, or ppm scales, making it extremely versatile for a wide range of applications. Though the meter is factory calibrated at 1413 μS , it also features digital calibration for easy and precise calibration to any point within its range.

CONTACT INFORMATION

If you have any problems or questions regarding your meter, please contact HM Digital, Inc

HM Digital, Inc.
Los Angeles, CA USA

Info@HMDigital.com
HMDigital.com
1-800-383-2777

SPECIFICATIONS

EC Range: 0 - 9990 μS ; 0 - 9.99 mS

TDS Range: 0 - 8560 ppm (mg/L); 0.7 (442™) scale, 0 - 5000 ppm (mg/L); 0.5 (NaCl) scale
0 - 8.56 ppt; 0.7 (442™) scale, 0 - 5.00 ppt; 0.5 (NaCl) scale

Temperature Range: 0 - 55°C; 32 - 130°F

Resolution:

EC: 0 - 99: 0.1 μS ; 100 - 999: 1 μS ; 1000 - 9990: 10 μS ; 0-9.99 mS: 0.01 mS

TDS: 0 - 99: 0.1 ppm; 100 - 999: 1 ppm; 1000 - 8560: 10 ppm / 0 - 8.56: 0.01 ppt

Temperature: 0.1 °C/°F

Accuracy: +/- 2% EC/TDS

+/- 1 °C/°F

EC-to-TDS Conversion Factor: Pre-programmed, non-linear conversions for 0.5 (NaCl) or 0.7 (442™) solutions, selected by the user

Temperature Compensation: Automatic (ATC) to 25°C (ATC range: 1-50°C)

Calibration: Digital calibration by push button (to any point within the range)

Auto Shut-Off: After 5 minutes

Probe: Detachable, with platinum electrodes

Display: LCD panel

Housing: Water resistant (splash proof)

Power source: 2 x 1.5V AAA Alkaline batteries(included)


Dimensions: 39.0 x 3.4 x 3.4 cm (15.4 x 1.3 x 1.3 inches)

Weight: 164g (5.8 oz) with batteries

HOUSING AND SCREEN DESCRIPTION


Housing

1. Lanyard hook
2. Battery compartment
3. LCD display
4. Button panel
5. Power button
6. Calibration mode, temperature mode, calibration-up button
7. EC/TDS mode, Hold, calibration-down button
8. Sensor gasket
9. Probe extension tube
10. Replaceable sensor (Part # SP-C1)

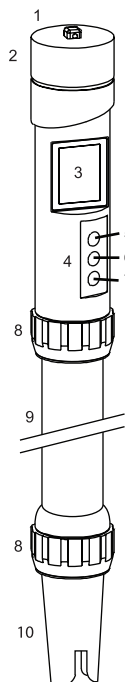

LCD Display

1. EC mode (μS)
2. EC mode (mS)
3. TDS mode (ppm)
4. TDS mode (ppt)
5. EC/TDS measurement
6. Calibration solution / conversion factor selected
7. Hold mode (appears when HOLD is pressed)
8. Temperature measurement
9. Celsius / Fahrenheit mode
10. Low battery indicator

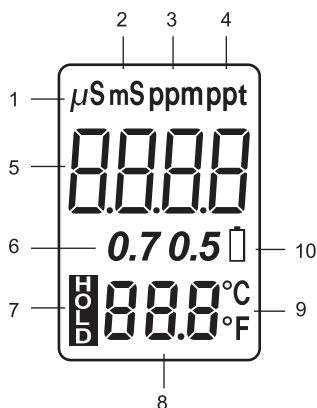


The COM-100L screen's backlit function is always turned on when using the meter.

TAKING MEASUREMENTS

The COM-100L can take measurements in Electrical Conductivity (EC), Total Dissolved Solids (TDS) and temperature. Please make sure to read the Switching Modes section to ensure that your meter displays the desired readings.

EC/TDS Measurements

1. Remove the cap.
2. Press the 'ON/OFF' button. The display will become active.
3. The default mode of the meter is for EC in the μS scale. To change the mode, press and hold the 'HOLD/MODE' button (see the Switching Modes section for more information). The unit will cycle through the six possible modes:
 - a. EC- μS
 - b. EC-mS
 - c. TDS - ppm (with 0.7 conversion factor and temperature coefficient)
 - d. TDS - ppm (with 0.5 conversion factor and temperature coefficient)
 - e. TDS - ppt (with 0.7 conversion factor and temperature coefficient)
 - f. TDS - ppt (with 0.5 conversion factor and temperature coefficient)
4. Release the 'HOLD/MODE' button when the display shows the desired mode.
5. Dip the meter into the water sample or solution to be tested.
6. Lightly swirl the meter and tap it against the bottom of the beaker to ensure the removal of trapped air bubbles or electric charges.
7. The meter will display a reading almost immediately. Keep the meter in the water until the reading stabilizes (approx. 30 seconds) for an accurate reading. **NOTE - Newer meters may take up to 2 minutes to fully stabilize. This time will decrease with usage as the sensor adapts.**
8. To view the reading out of the water, quickly press the 'HOLD/MODE' button while the meter is in the water. This will hold the reading on the screen. Quickly pressing the 'HOLD/MODE' button again will release it.
9. Press the 'ON/OFF' button to turn the meter off.
10. Shake any excess water off the meter and rinse with distilled or de-ionized water. Put the cap back on.



Temperature Measurements

The temperature reading is always displayed on the LCD panel during measurement mode, and is shown simultaneously for either EC or TDS readings. It is not shown when the meter is in calibration mode. The default temperature reading for the meter is in Celsius. To change the temperature mode, quickly press the 'TEMP/CAL' button to switch from Celsius to Fahrenheit or from Fahrenheit to Celsius.

1. Remove the cap.
2. Press the 'ON/OFF' button. The display will become active.
3. The temperature reading is always displayed on the LCD panel (except in calibration mode), and is shown simultaneously for either EC or TDS readings.
4. The default mode for temperature is Celsius. To change the temp mode, quickly press the 'TEMP/CAL' button to switch from Celsius to Fahrenheit or vice-versa.
5. Dip the meter into the water sample or solution to be measured.
6. The temp reading will change immediately (unless the solution is at room temperature). For very hot or cold liquids, the reading may take slightly longer to stabilize.
7. Press the 'ON/OFF' button to turn the meter off.
8. Shake any excess water off the meter and rinse with distilled or de-ionized water. Put the cap back on.

SWITCHING MODES

Electrical Conductivity (EC) and Total Dissolved Solids (TDS) Overview: While EC and TDS are often used synonymously, there are important differences to note. EC, when applied to water, refers to the electrical charge of a given water sample. TDS refers to the total amount of substances dissolved in the water other than the pure H₂O. The only true way of measuring TDS is to evaporate the water and weigh what's left. Since this is very difficult to do for the average person, we can estimate the TDS level by measuring the EC of the water. Every digital TDS meter in the world first measures the EC of the water and then converts that measurement to TDS.

All element have some electrical charge. Since different elements have different charges, it is necessary to convert the EC to TDS using a scale that mimics the charge of that water type. The following are the most common water samples, and for the COM-100L, each has its own non-linear conversion factor:

KCl: Potassium Chloride is the international standard to calibrate instruments that measure conductivity.

The COM-100L is factory calibrated with a 1413 μS (micro-Siemens) KCl solution.

442™: Developed by the Myron L Co., 442™ simulates the properties of natural water (rivers, lakes, wells, drinking water, etc.) with a combination of 40% Sodium Bicarbonate, 40% Sodium Sulfate, and 20% Sodium Chloride.

NaCl: Sodium Chloride is used in water where the predominant ions are NaCl, or whose properties are similar to NaCl, such as seawater and brackish water.

→ Measurements in EC (μS or mS) do not have a conversion factor.

How temperature affects the reading: temperature greatly affects both the EC and TDS readings. The international standard temperature for EC and TDS readings is 25° Celsius. Without a temperature compensation, the EC and TDS readings will increase when the temperature is greater than 25° and decrease when the temperature is lower than 25°. The COM-100L is equipped with the Automatic Temperature Compensation (ATC) fuction. The meter will automatically adjust the reading to what it would be at 25°. Each TDS conversion factor uses a specific ATC coefficient. The EC modes (μS or mS) use the Potassium Chloride (KCl) ATC coefficient. For additional information on TDS, please visit HMDigital.com and click on “what is TDS?” in EDUCATION CENTER.

Defaults: EC (μS) and the temperature reading in Celsius

Switching EC and TDS Modes:

The COM-100L has two different modes for EC. EC can be measured in two scales: μS (micro-Siemens) or mS (milli-Siemens). 1000 μS = 1 mS.

The COM-100L has six different modes for TDS. and measure are scales: ppm (parts per million) or ppt (parts per thousand), with 2 selectable conversion factors 0.7 or 0.5. 1000 ppm= 1 ppt.



NOTE - the scale icons appear above the measurement reading, and the conversion factor icons appear below the measurement reading. Since EC does not use a conversion factor, the conversion factor icons will not appear for the EC modes.

- EC- μS
- EC-mS
- TDS - ppm (442™) 0.7
- TDS - ppm (NaCl) 0.5
- TDS - ppt (442™) 0.7
- TDS - ppt (NaCl) 0.5

- When the meter displays the desired selection, release the ‘HOLD / MODE’ button.
- The meter is now ready for the use in your selected mode. The meter will keep this setting until changed again.

Switching Temperature Mode:

The temperature reading is always displayed on the LCD panel during measurement mode, and is shown simultaneously for either EC or TDS readings. It is not shown when the meter is in calibration mode. The default temperature reading for the meter is in Celsius. To change the temperature mode, quickly press the ‘TEMP/CAL’ button to switch from Celsius to Fahrenheit or from Fahrenheit to Celsius.

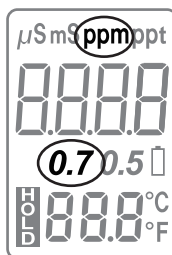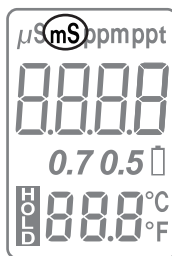

EC / TDS CALIBRATION

The COM-100L is factory calibrated to a 1413 μS KCl solution. The COM-100L will retain its calibration for a very long time, but there may be cases when it is necessary to recalibrate the meter. Additionally, though factory calibration will be suitable for most applications, it may be necessary to recalibrate the meter for more accurate results.

EC and TDS meters should be calibrated as close as possible to the range that will be measured. For example, if you are typically measuring the TDS levels of filtered water and tap water, it is recommended to recalibrate at a lower level. HM Digital's 342 ppm NaCl solution is highly recommended for this. For hydroponics, pools and aquarium testing, it may not be necessary to recalibrate the meter, or you may wish to recalibrate using HM Digital's 1000 ppm (2000 μS) NaCl solution. If you are unsure if your meter needs to be calibrated, always consult a professional prior to changing the calibration of the meter. Incorrectly calibrating the COM-100L may result in inaccurate measurements.


When to recalibrate the COM-100L: You will need to recalibrate if the factory calibration isn't suitable for your application (see above) or if the calibration has shifted. This can happen based on time, usage or care of the meter. The only method of determining and check the COM-100L is calibrated properly is to obtain a bottle of laboratory-certified EC or TDS calibration solution and check the meter against the solution value. The COM-100L can be calibrated to any brand or value EC or TDS Calibration Solution within the meter's range. Always calibrate to a fresh solution.

The COM-100L features digital calibration. To recalibrate the meter:


1. Turn the meter on by pressing the ON/OFF power button.
2. Make sure the meter is in the mode that matches the solution. If not, change the mode accordingly.
(For example, if you are calibrating to a 0.7 solution for TDS, change the mode to ppm 0.7. See Switching modes on page 4 for more information.)
3. Dip the meter into a laboratory-certified EC or TDS calibration solution. Lightly stir and tap the meter on the bottom of the glass to remove any air bubbles or lingering electrical charges.

NOTE- If the measurement matches the calibration solution value, then your COM-100L is already properly calibrated. Stop here!

4. Press and hold the 'TEMP/CAL' button. The temperature display will change to a 'CAL' image.
5. The meter will automatically adjust to a reading within a range of the calibration solution.
6. Change the reading so that it matches the calibration solution.
For example, if your calibration solution is 342 ppm, adjust the current reading until reads '342'. To increase the reading, press the 'UP' button (TEMP/CAL). To decrease the reading, press the 'DOWN' button (HOLD/MODE).

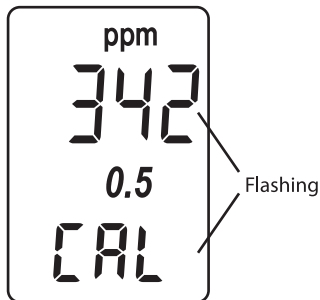

NOTE- If the calibration reading is lowered or raised to the minimum or maximum level within the range, the screen will display the 'minimum calibration reached' icon or 'maximum calibration reached' icon, respectively. Note that this occurs only within the range of the solution the meter is currently in. When 'CAL' does not flash, it means calibration is in the middle of the range. The meter does not restrict calibration.



7. To set the calibration, press the ON/OFF power button. You will see a flashing image on the screen that says "CAL". After flashing a few times, The flashing image will change to "END". (If the "END" image does not flash on the screen, the meter has not been properly calibrated).
8. Your meter is now recalibrated.

CARE, MAINTENANCE & TECHNIQUES

The COM-100L requires very little maintenance. You may need to change the batteries or clean the unit or the electrodes from time to time. In addition, please note these general techniques:

1. Do not store the unit in high temperatures or direct sunlight.
2. Do not touch the platinum electrodes. Skin oils may adversely affect the reading. If you do touch the electrodes, clean immediately with alcohol or distilled water.
3. After repeated usage in high TDS water, it is advised to clean the electrodes to prevent residue build-up.
4. For best results, always stir or tap the meter in the water sample to dislodge any air bubbles or remove any lingering electrical charges.
5. Water volume, positioning of the electrode in the water sample, and temperature may affect the reading.
6. Do not keep the meter in very hot water for extended periods of time.
7. If testing two water samples in a wide range (e.g., 15 ppm and 3000 ppm), make sure to rinse the electrodes with DI or distilled water or alcohol after each test to ensure accurate readings and prevent a build-up of TDS on the electrodes.
8. The COM-100L is waterproof. However, prior to completely submersing the meter into water, always ensure the blue probe gasket ring and battery compartment are secured tightly. The warranty does not cover water damage due to parts that are not secured properly.


Changing the batteries:

When the meter displays a flashing battery symbol, your batteries are getting weak and should be replaced soon.

To change the batteries:

1. Twist open the end cap on the top of the meter.
2. Twist the battery cap to the open position.
3. Remove the batteries.
4. Insert new batteries with the "+" side facing up.
The meter uses 2 x AAA batteries.
5. Close the battery cap and turn to the close position.
6. Close and tighten the end cap to maintain waterproofness.

NOTE: Do not reverse the polarity of the batteries.
This may short-circuit the meter.

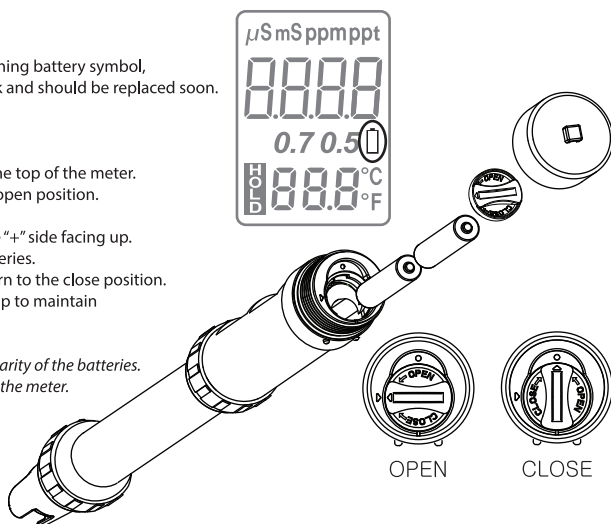

Cleaning:

To clean the unit, use a soft rag or towel. Wipe with water and mild soap.

To clean the electrodes, use rubbing alcohol and a cotton swab. Lightly clean the electrodes. Rinse with DI or distilled water. Air dry.

Electrode Replacement:

If your electrode has been damaged, you can purchase a new one without needing to purchase a new meter. To replace the electrode:

1. Remove the blue electrode locking ring by twisting it counterclockwise.
2. Gently pull the electrode off the unit.
3. Gently insert the new electrode into the unit. Be sure to align the grooves and six pins properly.
Never force the electrode into the unit!
4. Make sure the rubber ring is properly positioned on the electrode.
5. Screw the blue locking ring back onto the unit by twisting it clockwise. Tighten.

Message Symbols and Troubleshooting

You will see the corresponding message symbol(s) with the issues listed below:

Problem	Error Message	Reason(s) and/or Potential Solution(s)
The meter will not power on		1. Change the batteries. 2. Double-check the polarity of the batteries.
Incorrect Readings		1. Recalibrate the meter. 2. Switch modes.
The TDS/EC level is out of range (oor):	oor	1. (oor) The meter must be used within the specified range limits.
The sensor has been disconnected or damaged internally:	---- Err	1. (Error) Double-check the sensor is connected, or you may need a new sensor.
The temperature is out of range:	---- Err	1. (Error) The meter must be used within the specified temperature limits.

COM-100L LIMITED WARRANTY

1. COM-100L: One Year Limited Warranty

2. Detachable Sensor (SP-C1): One Year Limited Warranty

This HM Digital, Inc. ("the Company") product ("COM-100L") is warranted to the purchaser against defective materials and workmanship for one (1) year from the date of purchase.

****From the date of purchase, sensor (SP-C1) is warranted for one (1) year to the purchaser against defective materials and workmanship****

What is covered: Repair parts and labor, or replacement at the Company's discretion. Transportation Charges for repaired or new product to be returned to the purchaser.

What is NOT covered: Transportation charges for the defective products to be sent to the Company. Any consequential damages, incidental damages, or incidental expenses, including damages to property. This includes damages from abuse or improper maintenance such as tampering, wear and tear, water damage, or any other physical damage. The COM-100L is watertight and completely Submersible. However, please ensure that the battery compartment and probe gasket ring are firmly Tightened before submerging in water. The warranty does not cover water damage to the COM-100L due to parts not securely closed.

To obtain warranty service, please contact 800.383.2777 or email Warranty@HMDigital.com to receive further instructions. Before sending the product back to us, please include the following below,

- Your name
- Phone number/ Address
- Description of problem
- Proof of purchase, must include Date

**** If a returned product does not include the above-mentioned items, the Company Reserves the right to refuse warranty service.***

Implied Warranties: Any implied warranties, including implied warranties of merchantability and fitness for a particular purpose, are limited in duration to **ONE YEAR** from the date of purchase. Some states do not allow limitations on how long an implied warranty lasts, so the above limitation may not apply to you. To the extent any provision of this warranty is prohibited by federal and state law and cannot be preempted, it shall not be applicable. This warranty gives you specific legal rights, and you may also have other rights, which vary from state to state.

NOTE: Warranties are product-specific. Third-party products and products deemed by HM Digital as "accessories" are not covered under warranty. Third-party products include, but are not limited to, batteries and fittings. Accessories included, but not limited to, lanyards and product boxes.

This manual and all information contained herein copyright HM Digital, Inc. The contents of this manual cannot be reprinted without the permission of HM Digital, Inc.

442 and 442 Natural Water are registered trademarks of the Myron L Company.